



## MA3000 Series CAT IV TRMS 3000A AC Flex Clamp Meters

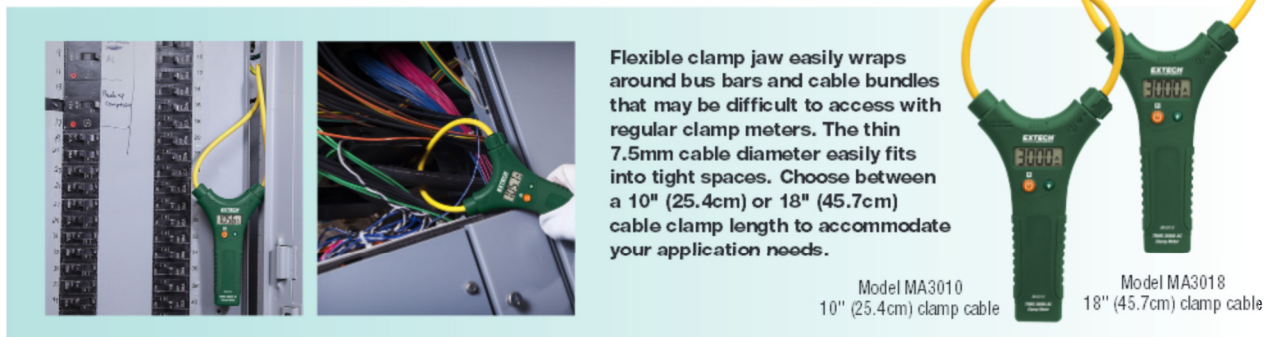

### Features

- True RMS for accurate readings of noisy, distorted or non-sinusoidal waveforms
- **Model MA3010** — 10" (25.4cm) flexible clamp cable
- **Model MA3018** — 18" (45.7cm) flexible clamp cable
- 7.5mm cable diameter fits into tight spaces and around large conductors
- Measures True RMS AC Current in three ranges
- 3000 count backlit LCD display
- Over range and Low battery indicator
- Auto power off with disable
- CAT III-1000V, CAT IV-600V category safety rating
- Complete with two AAA batteries

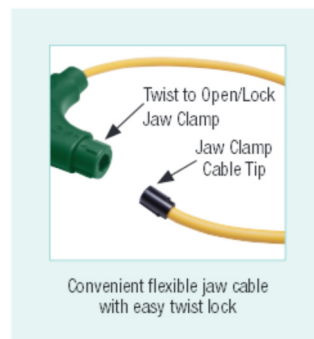

### Specifications

AC Current Ranges	0 to 30.00A, 30.00 to 300.0A, 300.0 to 3000A (autoranging)
Max Resolution	0.01A
Basic Accuracy	±(3%+5 digits)
Flex Cable Diameter	0.3" (7.5mm)
Flex Cable Tip Diameter	0.51" (13mm)
Dimensions	Model MA3010: 11 x 4.7 x 1" (280 x 120 x 25mm); Model MA3018: 13.8 x 5.1 x 1" (350 x 130 x 25mm)
Weight	Model MA3010: 6oz (170g); Model MA3018: 7.1oz (200g)

### Ordering

MA3010 **N** ..... CAT IV True RMS 3000A AC Flex Clamp Meter (10" clamp cable)

MA3018 **N** ..... CAT IV True RMS 3000A AC Flex Clamp Meter (18" clamp cable)

**N** Indicates products that are available with optional calibration traceable to NIST. Order with -NIST after part number for product plus Calibration Certificate.



MA3010 UPC Code: 793950373101  
MA3018 UPC Code: 793950373187